

Customer

XYZ

TAMPA, FLORIDA



generic logo company

UNIVERSITY SURVEY & ADA EVALUATION

Date

Priority 1 - Parking



PRESENTED TO:

Customer XYZ

PRESENTED BY:

Your Company.

Address 1234, Tampa, FL 33606

www.yourwebsite.com

PHONE: 777-777-777 FAX: 777-777-7777

Email: contact@yourwebsite.com


YOUR
LOGO → *Here*

Priority 1 - Parking



Overall Information

Total Number of Assets: 256
 Total Number Compliant Assets: 74
 Percentage of Compliant Assets: 28.91%
 Highest Risk building (Most Out of Compliant):
 Bldg 17 (42)
 Lowest Risk Building (Most Out of Compliant):
 Bldg 15 (4)

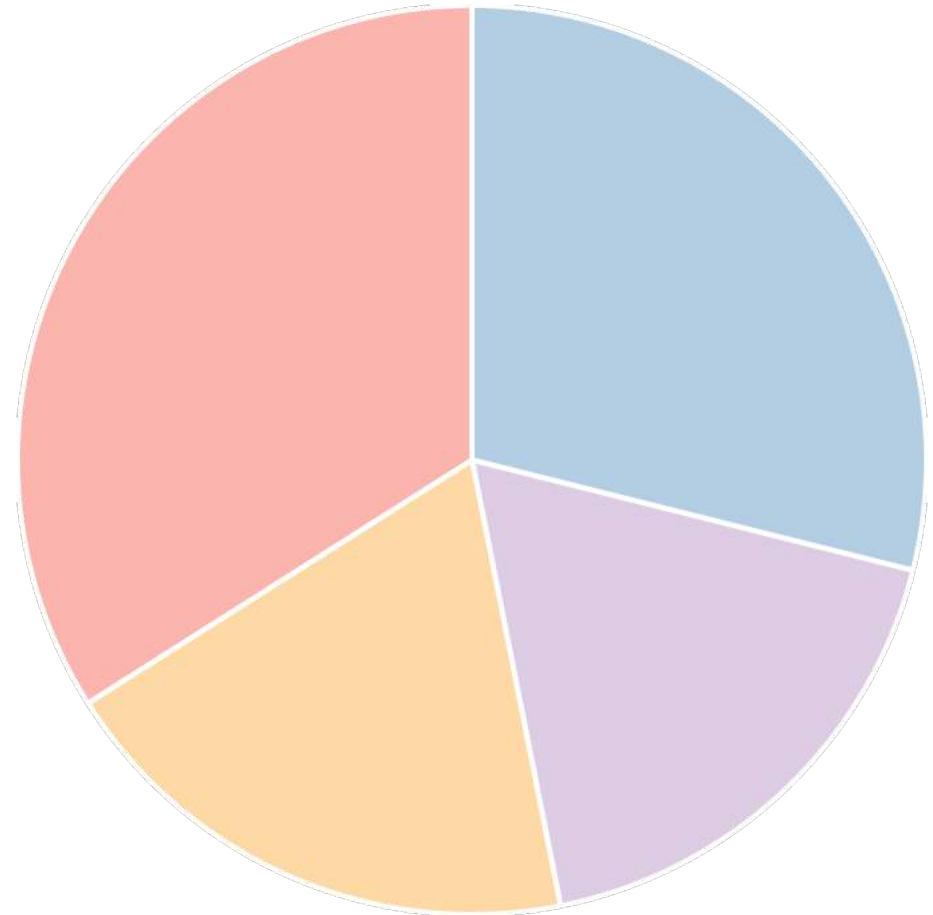

Count	Status
74	In Compliance (YES)
46	Needs Further Assessment
49	Not Inspected
87	Out of Compliance (NO)

Bldg Example 100


Priority 1 - Parking

Instance ID: 620

Latitude: 29.52922770609

Longitude: -89.197560045443

Overall status: Out of Compliance

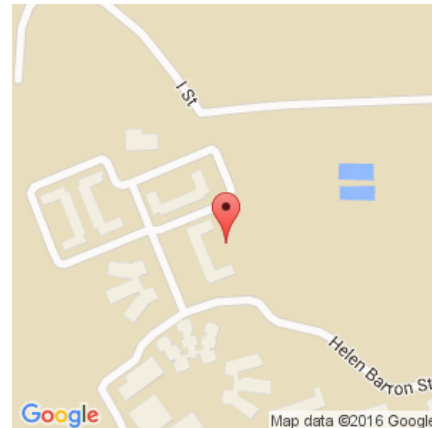

Section 1.2 Codes 502 parking spaces and 208.2 Minimum number

If parking is provided for the public, are an adequate number of accessible spaces provided?

Status: In Compliance (YES)

Value: There are 4 accessible spaces.

Comments: Findings - There are 4 accessible spaces. There are 3 van and 1 car accessible space.

Recommendations - There could be more access space.

Section 1.3 Codes 208.2.4 Van Parking Spaces

Of the accessible spaces, is at least one a van accessible space?

Status: In Compliance (YES)

Value: Yes

Comments: Findings - There are 3 van accessible spaces.

Section 1.4 Codes 505.2 Vehicle spaces and 502.3.1 Width

Are accessible spaces at least 8 feet wide with an access aisle at least 5 feet wide?

Status: Needs Further Assessment

Comments: Findings - The access space is 9 feet 2 inches and the access aisle is 60 inches or 5 feet.

Section 1.5 Codes 505.2 Vehicle spaces and 502.3.1 Width

Is the van accessible space - At least 11 feet wide with an access at least 5 feet wide? or At least 8 feet wide with an access aisle at least 8 feet wide?

Status: Needs Further Assessment

Comments: Findings - The access space is 11 feet and the access aisle is 5 feet.

If its answer A is the access aisle at least 5 ft wide?

Status: Needs Further Assessment

If its answer B is the access aisle at least 8 ft wide?

Status: Needs Further Assessment

Section 1.6 Codes 502.5 Vertical Clearance

Is at least 98 inches of vertical clearance provided for the van accessible space?

Status: In Compliance (YES)

Value: Yes

Section 1.7 Codes 502.3.3 Marking

Are the access aisles marked so as to discourage parking them?

Status: In Compliance (YES)

Value: Yes

Section 1.8 502.4 Floor or Ground Surfaces

Is the slope of the accessible parking spaces and access aisles no steeper than 1/48 in all directions?

Status: Needs Further Assessment

Section 1.9 502.3 Access Aisle

Do the access aisles adjoin an accessible route?

Status: In Compliance (YES)

Value: Yes

Section 1.10 502.6 Identification

Are accessible spaces identified with a sign that includes the International Symbol of Accessibility? Is the bottom of the sign at least 60 inches the ground?

Status: Out of Compliance (NO)

Value: The bottom of the sign is below 60 inches.

Comments: Findings - The signs range from 57 inches to 60 inches.



Section 1.11 Codes 502.6 Identification

Are there signs reading - Van Accessible - a van accessible space?

Status: In Compliance (YES)

Value: Yes

Comments: Findings - There are 3 van signs.

Section 1.12 Codes 208.3.1 General

Of the total parking spaces, are the accessible spaces located on the closet accessible route to the accessible entrance(s)?

Status: In Compliance (YES)

Value: Yes

Findings and Suggestions

Status: Out of Compliance (NO)

Value: The signs must be raised and I also recommend repainting the accessible parking spots.

Inspectors Signature

Status: Out of Compliance (NO)



Signed by Bob Inspector May 10, 2016 15:39

Bldg Example 100

Priority 1 - Parking

Instance ID: 620
Latitude: 29.52922770609
Longitude: -89.197560045443
Overall status: Out of Compliance



Section 1.2 Codes 502 parking spaces and 208.2 Minimum number

If parking is provided for the public, are an adequate number of accessible spaces provided?

Status: Out of Compliance (NO)

Value: This area is accessed by persons who live in the building and the public. However the parking area is 100% out of compliance with any parking requirements



Section 1.3 Codes 208.2.4 Van Parking Spaces

Of the accessible spaces, is at least one a van accessible space?

Status: Out of Compliance (NO)

Value: There is no accessible parking at the rear or west side of Reed Hall

Section 1.4 Codes 505.2 Vehicle spaces and 502.3.1 Width

Are accessible spaces at least 8 feet wide with an access aisle at least 5 feet wide?

Status: Out of Compliance (NO)

Value: There is no accessible parking at the rear or west side of Reed Hall

Section 1.5 Codes 505.2 Vehicle spaces and 502.3.1 Width

Is the van accessible space - At least 11 feet wide with an access at least 5 feet wide? or At least 8 feet wide with an access aisle at least 8 feet wide?

Status: Out of Compliance (NO)

Value: There is no accessible parking at the rear or west side of Reed Hall

If its answer A is the access aisle at least 5 ft wide?

Status: Out of Compliance (NO)

If its answer B is the access aisle at least 8 ft wide?

Status: Out of Compliance (NO)

Value: There is no accessible parking at the rear or west side of Reed Hall

Section 1.6 Codes 502.5 Vertical Clearance

Is at least 98 inches of vertical clearance provided for the van accessible space?

Status: Out of Compliance (NO)

Value: There is no accessible parking at the rear or west side of Reed Hall. However if accessible parking or available height requirement would be met

Section 1.7 Codes 502.3.3 Marking

Are the access aisles marked so as to discourage parking them?

Status: Out of Compliance (NO)

Value: Nojü

Section 1.8 502.4 Floor or Ground Surfaces

Is the slope of the accessible parking spaces and access aisles no steeper than 1/48 in all directions?

Status: Out of Compliance (NO)

Value: The ground is not properly sloped for any particular transportation requirement. However it can be made to slop correctly

Section 1.9 502.3 Access Aisle

Do the access aisles adjoin an accessible route?

Status: Out of Compliance (NO)

Value: There are no adjoining accessible Aisles

Section 1.10 502.6 Identification

Are accessible spaces identified with a sign that includes the International Symbol of Accessibility? Is the bottom of the sign at least 60 inches the ground?

Status: Out of Compliance (NO)

Value: No symbol exist at this location

Section 1.11 Codes 502.6 Identification

Are there signs reading - Van Accessible - a van accessible space?

Status: Out of Compliance (NO)

Value: No handicap signs for parking signs at this location

Section 1.12 Codes 208.3.1 General

Of the total parking spaces, are the accessible spaces located on the closet accessible route to the accessible entrance(s)?

Status: Out of Compliance (NO)

Value: There are no documented handicap parking

Findings and Suggestions

Status: Out of Compliance (NO)

Value: Such as resurfacing the parking area and placing the appropriate signs. Or, put up sign stating no parking.

Inspectors Signature

Status: Out of Compliance (NO)



Signed by Bob Inspector

May 10, 2016 15:39

Bldg Example 12

Priority 1 - Parking

Instance ID: 620
Latitude: 29.52922770609
Longitude: -89.197560045443
Overall status: Out of Compliance




Section 1.2 Codes 502 parking spaces and 208.2 Minimum number

If parking is provided for the public, are an adequate number of accessible spaces provided?

Status: Out of Compliance (NO)

Value: No

Comments: There are only four out of 80 parking spaces that are for the handicapped.

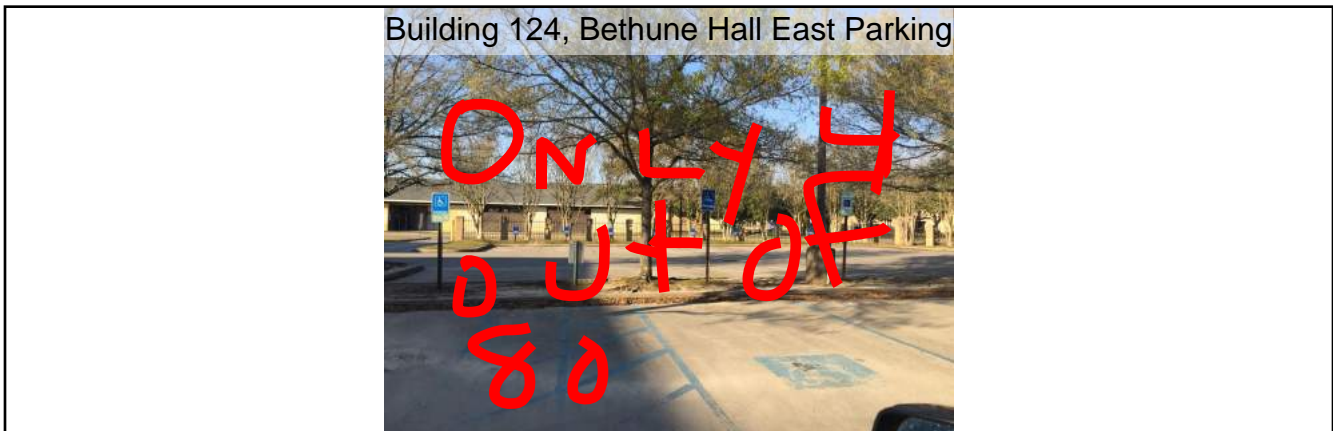

Section 1.3 Codes 208.2.4 Van Parking Spaces

Of the accessible spaces, is at least one a van accessible space?

Status: In Compliance (YES)

Value: Yes

Section 1.4 Codes 505.2 Vehicle spaces and 502.3.1 Width

Are accessible spaces at least 8 feet wide with an access aisle at least 5 feet wide?

Status: In Compliance (YES)

Value: Yes

Section 1.5 Codes 505.2 Vehicle spaces and 502.3.1 Width

How wide is the van accessible space

Status: Needs Further Assessment

Value: B) greater than 8 ft but less than 11 ft

If its answer A is the access aisle at least 5 ft wide?

Status: In Compliance (YES)

Value: Yes

If its answer B is the access aisle at least 8 ft wide?

Status: In Compliance (YES)

Value: Yes

Section 1.6 Codes 502.5 Vertical Clearance

Is at least 98 inches of vertical clearance provided for the van accessible space?

Status: In Compliance (YES)

Value: Yes

Section 1.7 Codes 502.3.3 Marking

Are the access aisles marked so as to discourage parking them?

Status: In Compliance (YES)

Value: Yes, but they could be updated to reflect stronger color

Section 1.8 502.4 Floor or Ground Surfaces

Is the slope of the accessible parking spaces and access aisles no steeper than 1/48 in all directions?

Status: In Compliance (YES)

Value: Yes

Section 1.9 502.3 Access Aisle

Do the access aisles adjoin an accessible route?

Status: Out of Compliance (NO)

Value: No

Section 1.10 502.6 Identification

Are accessible spaces identified with a sign that includes the International Symbol of Accessibility? Is the bottom of the sign at least 60 inches the ground?

Status: In Compliance (YES)

Value: Yes

Section 1.11 Codes 502.6 Identification

Are there signs reading - Van Accessible - a van accessible space?

Status: In Compliance (YES)

Value: Yes

Section 1.12 Codes 208.3.1 General

Of the total parking spaces, are the accessible spaces located on the closet accessible route to the accessible entrance(s)?

Status: In Compliance (YES)

Value: Yes

Findings and Suggestions

Status: Out of Compliance (NO)

Value: More handicapped parking spaces are needed. Accessible lanes to the building should be provided. Access ramp to the building needs to be better marked, and it should include visual ridges feel ridges for the visually impaired

Inspectors Signature

Status: Out of Compliance (NO)



Signed by Bob Inspector

May 10, 2016 15:39

Bldg Example 12

Priority 1 - Parking

Instance ID: 620
 Latitude: 29.52922770609
 Longitude: -89.197560045443
 Overall status: Out of Compliance



Section 1.2 Codes 502 parking spaces and 208.2 Minimum number

If parking is provided for the public, are an adequate number of accessible spaces provided?

Status: Out of Compliance (NO)

Value: 2 spaces provided



Section 1.3 Codes 208.2.4 Van Parking Spaces

Of the accessible spaces, is at least one a van accessible space?

Status: In Compliance (YES)

Value: Yes

Section 1.4 Codes 505.2 Vehicle spaces and 502.3.1 Width

Are accessible spaces at least 8 feet wide with an access aisle at least 5 feet wide?

Status: In Compliance (YES)

Value: Space is accessible but markings are not clear

Section 1.5 Codes 505.2 Vehicle spaces and 502.3.1 Width

How wide is the van accessible space

Status: Needs Further Assessment

Value: A) greater than or equal 11 ft wide

If its answer A is the access aisle at least 5 ft wide?

Status: Needs Further Assessment

If its answer B is the access aisle at least 8 ft wide?

Status: Needs Further Assessment

Section 1.6 Codes 502.5 Vertical Clearance

Is at least 98 inches of vertical clearance provided for the van accessible space?

Status: Needs Further Assessment

Section 1.7 Codes 502.3.3 Marking

Are the access aisles marked so as to discourage parking them?

Status: Out of Compliance (NO)

Value: Aisles are marked but not clearly visible



Section 1.8 502.4 Floor or Ground Surfaces

Is the slope of the accessible parking spaces and access aisles no steeper than 1

Status: Needs Further Assessment

Value: 48 in all directions?

Section 1.9 502.3 Access Aisle

Do the access aisles adjoin an accessible route?

Status: Out of Compliance (NO)

Value: Not all access aisles adjoin an accessible route



Section 1.10 502.6 Identification

Are accessible spaces identified with a sign that includes the International Symbol of Accessibility? Is the bottom of the sign at least 60 inches the ground?

Status: Out of Compliance (NO)

Value: Signs are not required height



Section 1.11 Codes 502.6 Identification

Are there signs reading

Status: Not Inspected

Section 1.12 Codes 208.3.1 General

Of the total parking spaces, are the accessible spaces located on the closet accessible route to the accessible entrance(s)?

Status: Out of Compliance (NO)

Value: No

Findings and Suggestions

Status: Out of Compliance (NO)

Value: University should really invest in striping. University should we invest in resurfacing.

Recommend marking clear Isles from handicap parking to curb approach

Inspectors Signature

Status: Out of Compliance (NO)



Signed by Bob Inspector

May 10, 2016 15:39